

Project:

713 South Pear Orchard Road, Suite 100 Ridgeland, Mississippi 39157 Office 601.977.8993 Fax 601.977.8924 www.allenhoshall.com

24 March 2017

CONTRACT AMENDMENT

NO. __4_

Installation of New Reactor Clarifier - Water Treatment Plant

Owner:	City of Vicksburg, Mis	ssissippi		
Contractor: Greenbriar Digging Service Limited Partnership				
The cor below. Desc	ntract, dated <u>8 January</u> cription of and reason t	2016 between the or amendment:	above listed parties, is hereby	amended as set forth
Addition of repair of damaged bearing and drive portions of Clarifier No. 1 as outlined in the attached proposal from Greenbriar. This work is in addition to the damaged portions of Clarifier No. 1 replaced in Contract Amendment No. 3. Work on Clarifier No. 1 is in addition to the original scope of the project for replacement of Clarifier No. 2.				
			9	
Contract Amount is Amended as Follows: Contract Time is Amended as Follows:				
Present Contract Amount		\$1,417,300.00	Present Completion Date	13 November 2016
Net Change in Contract		\$18,720.00	Net Change-No. of Days	121
Amended Contract Amount		\$1,436.020.00	Amended Completion Date	17 March 2017
Recommended by Zun & Ordy				:
	Approved by	Gl	Contractor	- C
	Approved by		Owner	



1941 Highway 550 NW Brookhaven, MS 39601-9615 Telephone: 601-833-0975

Fax: 601-833-0986

COST INFORMATION FOR CHANGE ORDER

DATE:

March 21, 2017

JOB NAME:

Vicksburg Clarifier

TO:

Ed Dedeaux, P.E.

Allen & Hoshall

713 S. Pear Orchard Road, Suite 100

LOCATION:

Water Treatment Plant

Vicksburg, MS

Ridgeland, Mississippi 39157 UNIT COST EXTENSION UNIT ITEM DATE While leveling the newly installed rake arm cage, we found 3-1-17 that the bolts attaching the rake arm gear drive to the main gear housing were loose. It allowed enough movement in the drive that it pushed the site glass into the king's post, breaking the site glass and draining the rake gear drive of most of its oil. (See e-mail from this date). The Ovivo representative came for a scheduled visit and 3-2-17 had us pull the rake arm gearbox so that he could inspect the interior of the gear, (he wanted to do this as a result of the loose holts). We found that the lower pinion bearing and bearing race were damaged and the Ovivo rep recommended that they be replaced. We spoke with all involved and ordered the necessary materials. 8 hrs. of extra work. New materials were delivered as specified. When installing 3-6-17 the new bearings, we found that there was an additional damaged bearing on the rake arm worm drive, (see attached pictures). We spoke with all involved and ordered the necessary materials. 10 hrs. of extra work. While waiting on delivery of the new bearings we proceeded 3-7-17 with the leveling of the rake arms again. We then found that the main gear drive was not securely fastened to the center column, 8 hrs. of extra work. 3-8-17 We shimmed and leveled the main gear drive. 9 hrs. of extra work.

> \$ 18,720.00 LS \$ 18,720.00

ACCEPTED: CITY OF VICKSBURG

3-9-17 Torqued the main gear drive bolts and completed the leveling

3-15-17 Replaced all new bearings, oll seals, and changed oil in all locations on gear assembly. 11.5 hrs of extra work.

of the entire assembly. 4 hrs. of extra work.